

INSPECTED ARTICLE(S)



Item: 2206/092/040



Item: 2206/092/040

A. GENERAL INFORMATION

Client Name	N/A	P.O. Number	71497-43/71498-43
Vendor Name	N/A	Item Number	2206/092/040
Inspection Date	N/A	Product Name	DEPORTIVO RUNNING PWRD+
Inspection Location	N/A	Booking/Shipment Total Quantity	3502/3502
Inspection Type	Final Random Inspection (FRI)	Combined Sampling	No

B. INSPECTION RESULTS

OVERALL CONCLUSION	Not Conform Due to Remark#7 and Pending for Remark#1-6, 8
---------------------------	---

INSPECTION SUMMARY	Conform	Not Conform	Pending	Not Applicable	Remark
Client special check points		✓			Remark#7
Visual and Workmanship			✓		Remark#8
Quantity Conformity			✓		Remark#1
Product & Package Conformity			✓		Remark#2-6
Data Measurement / Field Test		✓			Remark#7

C1. PROBLEM REMARKS

NO.	Description
1	Upon arrival, about 3000 pairs (85.67%) of products were finished producing, and 2850 pairs (81.38%) of products were packed into cartons, the others were still under producing and packing.
2	No approval sample was provided by client, only factory's reference sample was provided for reference.
3	No detail marking / packing specification were provided for reference.
4	The carton for packing (size 39-42) was B4 instead of A2 as stated on spec.
5	The product image on product sticker was printed in black and white instead of color printed, and the actual appearance on lateral quarter was inconsistent with image on spec and actual product sticker.
6	The type-setting of hangtag was inconsistent with spec.
7	The actual outsole hardness was 59-61 grades (test 5 pairs, 2 pair was 59 grades, 2 pair was 60 grades, 1 pair was 61 grades).
8	About 25% of inspected samples were found the visible asymmetric beginning or ending position of painting line on midsole.

LEFTIES

Standardized packing

Packing
M6 AS
A2 AS

Pairs	Packing
010	43 44 45
012	39 41 42 40

Remark 4: The carton for packing (size 39-42) -A2 as stated on spec

Remark 4: The carton for packing (size 39-42) -A2 as stated on spec



Remark 4: The carton for packing (size 39-42)-B4 actual finding

Remark 4: The carton for packing (size 39-42)-B4 actual finding



Remark 4: The carton for packing (size 39-42)-B4 actual finding

MEX 26 40

2206/092/040
NEGRO_BLACK_NOIR
DEPORTIVO RUNNING PWRD+



lefties - MADE IN CHINA



1 2206 092 040 40 4

Remark 5: product image-color printed and appearance of lateral quarter on spec

MEX 26 40

2206/092/040
NEGRO/BLACK/NOIR
DEPORTIVO RUNNING PWRD+



lefties - MADE IN CHINA



1 2206 092 040 40 4

Remark 5: product image-black and white printed and appearance of lateral quarter-actual finding



Remark 5: actual product appearance on lateral quarter



Remark 5: actual product appearance on lateral quarter

lefties

TEMPE,S.A. AV. DIPUTACION ED. INDITEX ARTEIXO - A CORUNA (SPAIN) C.I.F.: ESA-15.234.065; ОБУВЬ - ИЗГОТОВИТЕЛЬ: TEMPE S.A., УЛ. ЕПУТАСЪОН, ЗДАНИЕ ИНДИТЕКС АРТЕЙШО - ЛА КОРУНЯ (ИСПАНИЯ) C.I.F.: ESA - 15.234.065. УПОЛНОМОЧЕННЫЙ ИМПОРТЕР, ПРОДАВЕЦ: ООО «ЛФТ РУС», Г. МОСКВА, ПРЕСНЕНСКАЯ НАБ., 10

HECHO EN CHINA - FABRICADO NA CHINA - MADE IN CHINA - FABRIQUÉ EN CHINE - GEFABRICCEED IN CHINA - FATTO IN CINA - HERGESTELLT IN CHINA - KATAIKETHI KINA - ÜRETİM YERİ ÇİN - FREMSTILLET I KINA - DIBUAT DI TIONGKOK - صنع في الصين - FEITO EN CHINA - FET A LA XINA - TXINAN EGINA - СДЕЛАНО В КИТАЕ



Remark 6: type-setting of hangtag-on spec

C2. INFORMATIVE REMARKS

NO.	Description
1	The hook was not fastened on shoes, packed inside polybag directly.
2	Master carton sticker's QR code was read as digital.
3	Found one barcode on master carton read as "0000000000".
4	All inspection photos you can reach at below link https://www.testcoo.com/original_photos



Informative remark 1: The hook was not fastened on shoes, packed inside polybag directly.



Informative remark 1: The hook was not fastened on shoes, packed inside polybag directly.



Informative remark 2: Master carton sticker's QR code was read as digital.



Informative remark 3: Found one barcode on master carton read as "0000000000".

D. Client Special Check Points

Item	Title	Client special check point	Result
2206/092/040	1	Bring an asker A to check outsole hardness. It must be 60 grades. (Bulk found 59-61 Grades)	Not Conform



Outsole hardness result



Outsole hardness result



Outsole hardness result


N/A

E. Visual and Workmanship

Inspection Standard	ANSI/ASQ Z1.4 Single Sampling Plan		
Inspection Level	II		
Defect Classification	Critical	Major	Minor
AQL	0	2.5	4.0
Sample Size	200	200	200
Max Allowed	0	10	14
Total Found	0	4	12

Details of Defect Found	Critical	Major	Minor
For Item #2206/092/040, Sample Size: 200			
Damaged mark on vamp (0.5cm)	0	1	0
Puckering mark on lateral quarter (over 3cm)	0	1	0
High-low back counter (deviation 0.5cm)	0	1	0
Poor hot sealing on vamp (over 3cm)	0	1	0
Glue mark on vamp (0.5-1.5cm)	0	0	5
Gear mark on vamp (over 3cm)	0	0	3
Color stain on vamp / midsole (0.5-1cm)	0	0	3
Poor punching hole on vamp	0	0	1

For Item #2206/092/040

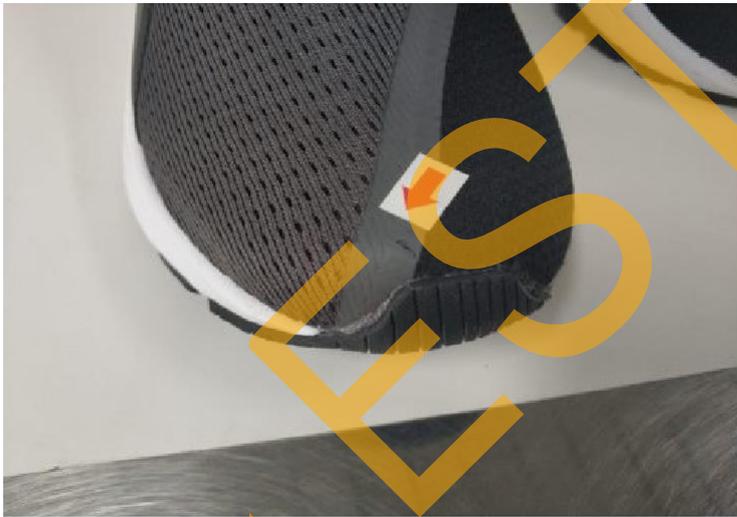

Damaged mark on vamp-major



Puckering mark on lateral quarter -major



High-low back counter-major



Poor hot sealing on vamp-major



Glue mark on vamp-minor



Glue mark on vamp-minor



Glue mark on vamp-minor



Glue mark on vamp-minor



Glue mark on vamp-minor



Gear mark on vamp-minor



Gear mark on vamp-minor



Gear mark on vamp-minor



Color stain on vamp-minor



Color stain on vamp-minor



Color stain on midsole-minor



Poor punching hole on vamp-minor

F. Quantity Conformity

Item Number	P.O. No	Order Qty	Shipment Qty	Presented Qty for inspection		Number of Cartons		QTY Not Finished
				Packed	Not packed	Packed	Not packed	
2206/092/040	71497-43	528	528	528	0	88	0	0
2206/092/040	71498-43	2974	2974	2322	150	208	60	502
Total		3502	3502	2850	150	296	60	502
Total 21 cartons were selected randomly Selected carton number								
If carton number available	Yes							
Carton number	PO#71497-43: 23, 11, 80, 72, 39, 58, 8 PO#71498-43: 2, 7, 135, 129, 63, 49, 56, 34, 25, 158, 214, 226, 239, 268							

G. Product and Package Against Approval Sample/Documents

Inspection Reference	Reference Sample , Product Spec , Booking			
Check point	Conform	Not Conform	Pending	Not Applicable
Product Appearance			✓	
Accessories			✓	
Packing			✓	
Labeling / Marking			✓	

H. Data Measurement / Field Test

	Test Item	Test Requirement	Test Data	Test Quantity	Test Result
1	Carton drop test	With reference to ISTA 1A drop test method. The package or product should not be damaged after the test	No failure	1 carton	Conform
2	Assortment check	The packing assortment should be correct as client's requirement and package marking	No failure	All selected cartons	Conform
3	Color shade check	According to client's requirement. If no client's requirement, please adopt below: 1.No color shade within same pair is allowed. 2.The color shade in the whole shipment with grey scale 4 is allowed for dark color, with grey scale 4-5 is allowed for light color.	No failure	All sample size	Conform
4	Flexing test	Check the flexibility of the shoe (make a curve in both direction with the shoe in hand)	No failure	5 pairs	Conform
5	Product Size Measurement	According to product spec or approved sample. Apply +/- 3% if no detail tolerance issued or requirement from client	No failure	3 pairs per size	Actual Finding
6	Tape test on printed/coating label	Use 3M tape for testing. The marking should not peel off. 1. Use 3M adhesive tape paste on the marking, let the tape paste more firm by pressing 2. Tear off the tape on 45 degree fast 3. Check the tape and the sample whether the marking peeling off or not	No failure	5 pairs	Conform
7	Fitting check	The shoes should be fit the intended model feet or person feet well	No failure	2 per size	Conform
8	Barcode scan check (At least on piece per barcode type)	The barcode must be scannable and with the correct number.	No failure	2 per barcode	Conform
9	Rocking & flat check	Check the stability of the shoe on flat surface. Put the shoe flat on table, give a small tap on the right side of the back heel & see if the shoe is falling/moving or not	No failure	All sample size	Conform
10	Odor and Mildew check	Should not have irritative odor and Mildew.	No failure	All sample size	Conform
11	Color fastness test	By using a wet white cloth, rub on the inspected cloth back and forth 5 times, to see if there is any color left on the white cloth	No failure	5 pairs	Conform
12	QR code check	The QR label should be read out by mobile phone.	No failure	5 pcs	Conform
13	Insole check	No any sharp point, broken metallic, foreign material and torn hole inside.	No failure	All sample size	Conform
14	Outsole hardness check	It must be 60 grades.	Bulk found 59-61 Grades	5 pairs	Not Conform

Measurement chart

Item No.↵	Checking↵	Carton size (cm)↵	Carton weight (kg)↵
2206/092/040↵	B4-12 pairs packing carton↵	67.0x57.6x36.6↵	Min GW: 5.45↵ Max GW: 10.43↵
	M6-12 pairs packing carton↵	60.0x50.5x36.5↵	
	6 pairs packing carton↵	46.6x38.6x34.8↵	

Measurement chart

Size↵	39↵	40↵	41↵	42↵	43↵	44↵	45↵
Shoe length (mm)↵	258↵	265↵	273↵	279↵	285↵	291↵	299↵
Shoe length (mm)↵	259↵	265↵	272↵	278↵	285↵	292↵	298↵
Shoe length (mm)↵	258↵	266↵	272↵	279↵	284↵	291↵	299↵

Measurement chart

VALIDATION TEAM

Inspected by Inspection date	N/A
Reviewed by Review date	N/A
Approved by Review date	N/A

I. INSPECTION PHOTO (All inspection related photos with descriptions)

For Item #2206/092/040



Carton view for PO#71497-43




Carton view for PO#71497-43



Carton sticker



Carton open view

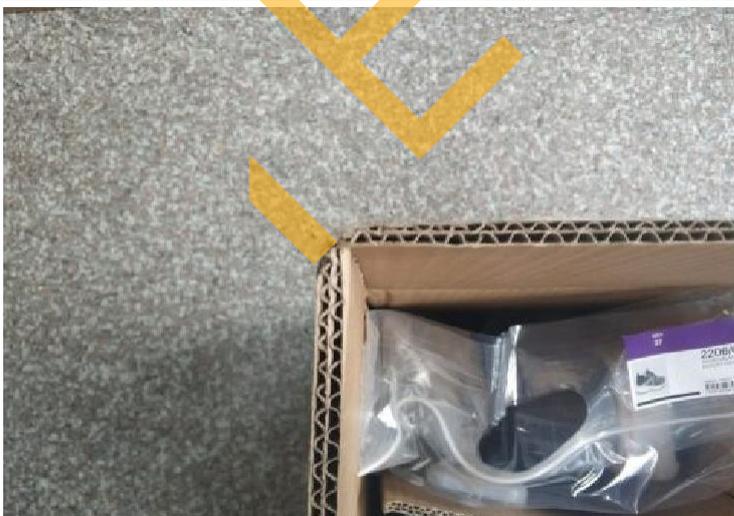

5-ply corrugated




Carton packing



Unit packing



Polybag view

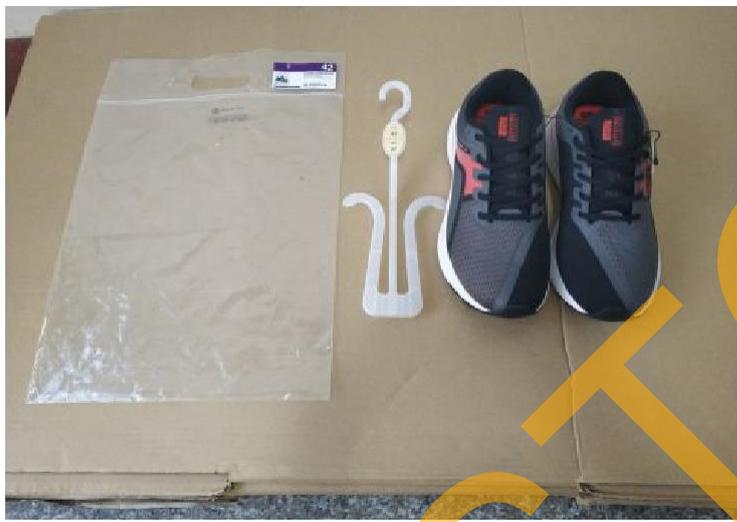

Unit packing



Product sticker



Anti-mold sticker



Hanger view



Hanger sticker



Hanger view



Air hole on polybag



Product view



Product view



Product view



Product view




Product view



Product view



Product view

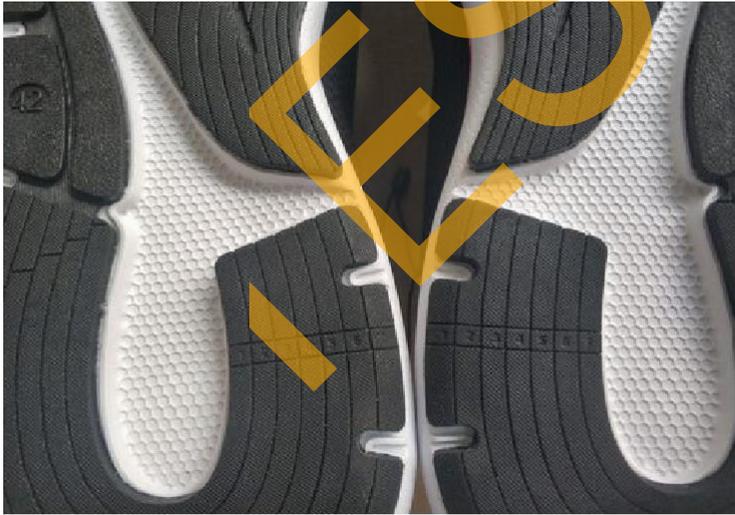

Product view



Product view



Product view



Product view



Product packing



Product view



Product view



Product view



Size label



Shoelace



Product view



Hangtags



Hangtag



Hangtag



Compared with reference sample (left)



Compared with reference sample (left)



Compared with reference sample (left)



Reference sample



Reference sample



Reference sample



Carton view for PO#71498-43 B4



Shipping mark for B4



Shipping mark for B4



Shipping mark for B4



Shipping mark for B4



Shipping mark for B4



Shipping mark for B4



Shipping mark for B4



Shipping mark for B4



Carton packing




Carton view for PO#71498-43 M6



Shipping mark for M6



Shipping mark for M6

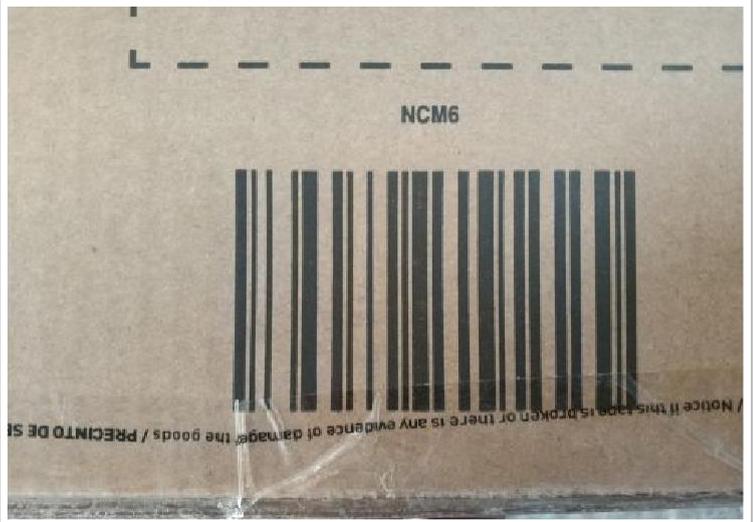

Shipping mark for M6



Shipping mark for M6



Shipping mark for M6



Shipping mark for M6




Shipping mark for M6



Carton packing



Carton sticker

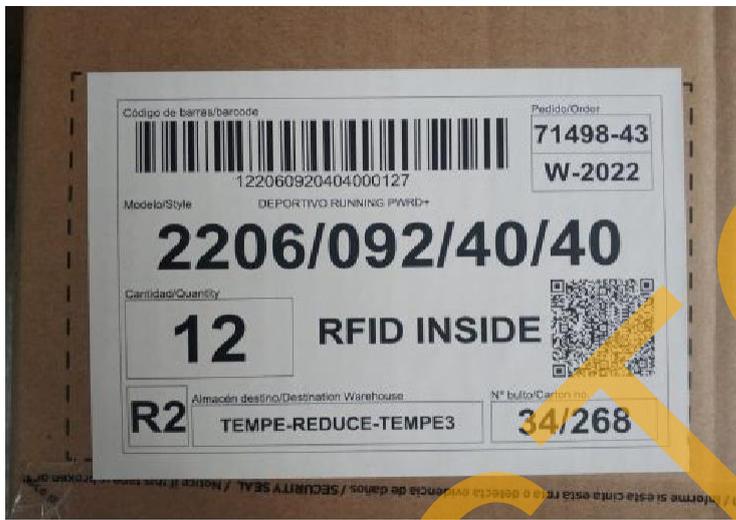

Carton sticker



Carton sticker



Carton sticker



Carton sticker



Carton sticker



Carton sticker



Product sticker-size 39



Hanger sticker-size 39



Hangtag-size 39



Hangtag-size 39



Size label-size 39



Product sticker-size 40



Hanger sticker-size 40



Hangtag-size 40



Hangtag-size 40



Size label-size 40



Product sticker-size 41



Hanger sticker-size 41



Hangtag-size 41



Hangtag-size 41



Size label-size 41



Product sticker-size 43



Hanger sticker-size 43



Hangtag-size 43




Hangtag-size 43



Size label-size 43



Product sticker-size 44

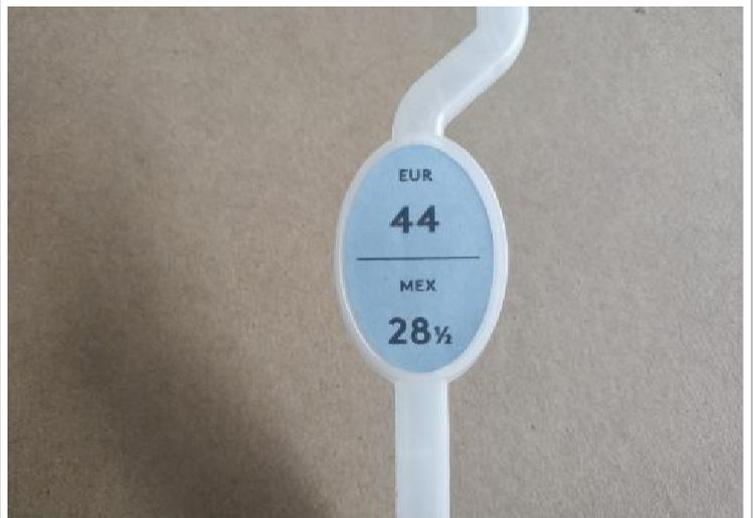

Hanger sticker-size 44



Hangtag-size 44



Hangtag-size 44



Size label-size 44



Product sticker-size 45



Hanger sticker-size 45



Hangtag-size 45



Hangtag-size 45




Size label-size 45

Test photo



Carton dimension

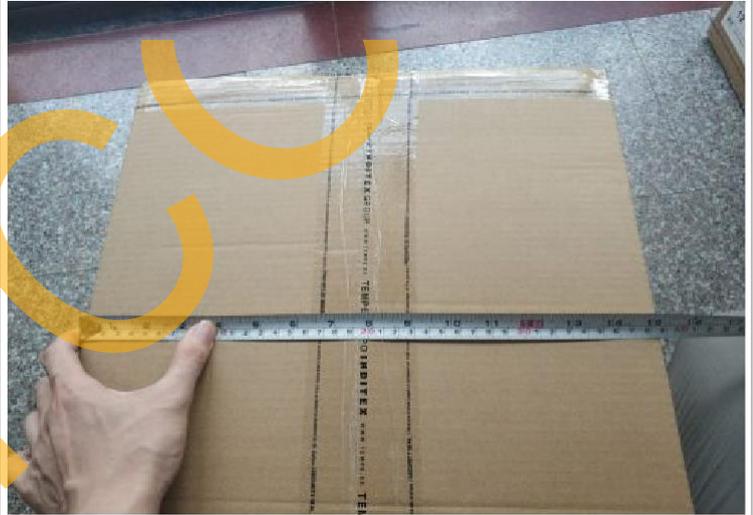

Carton dimension



Carton dimension




Carton gross weight



Barcode scan check



QR code check

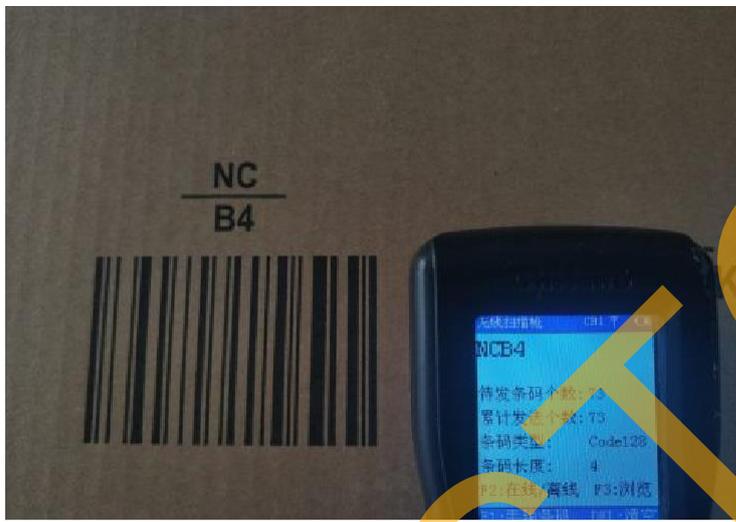

Barcode scan check



Barcode scan check



Barcode scan check



Color fastness check




Color fastness check



Coating tape test



Coating tape test

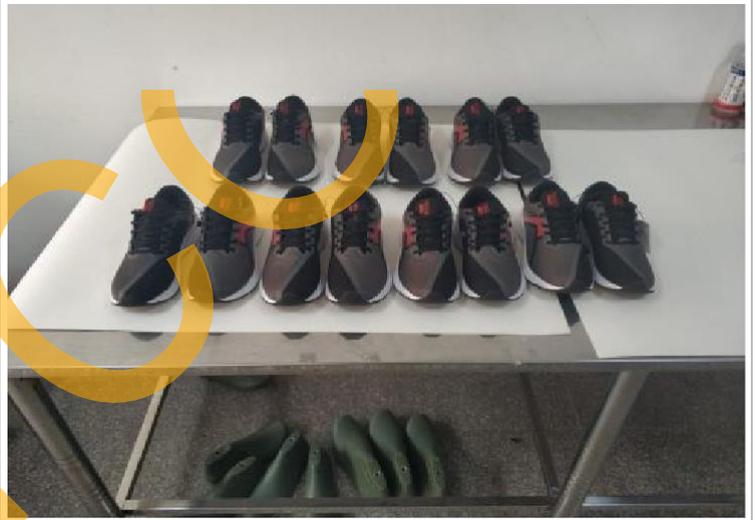

Color shade check



Flexing check



Bonding check




Rocking & flat check




Insole check




Insole length check

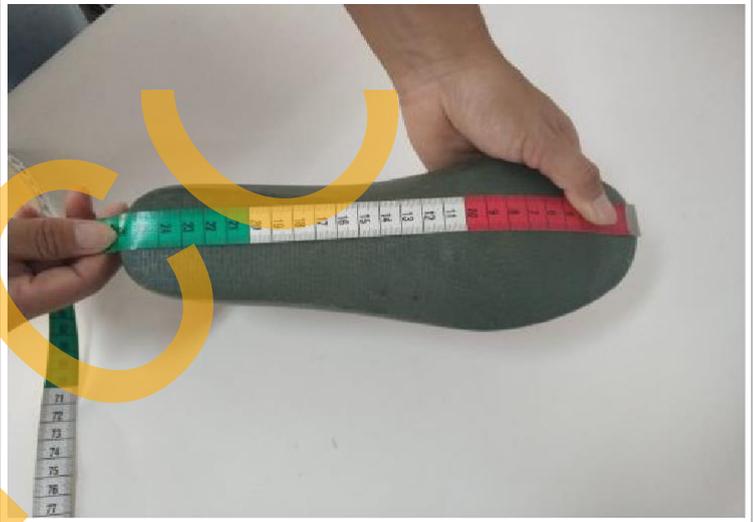


Insole length-size 39

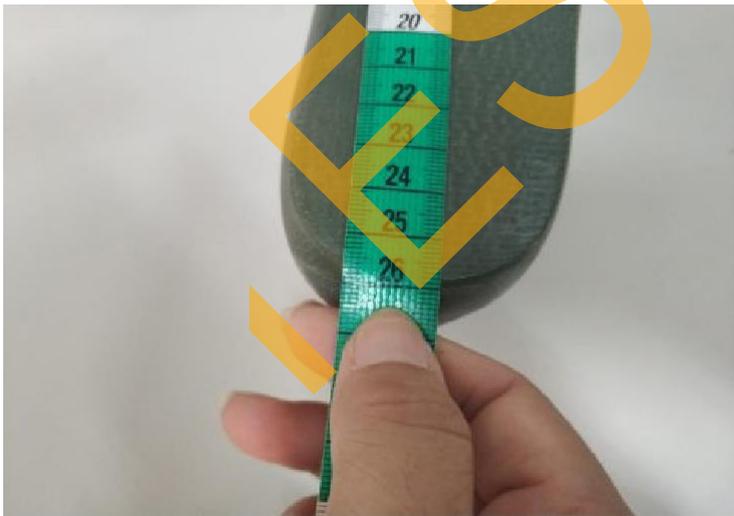

Insole length-size 30

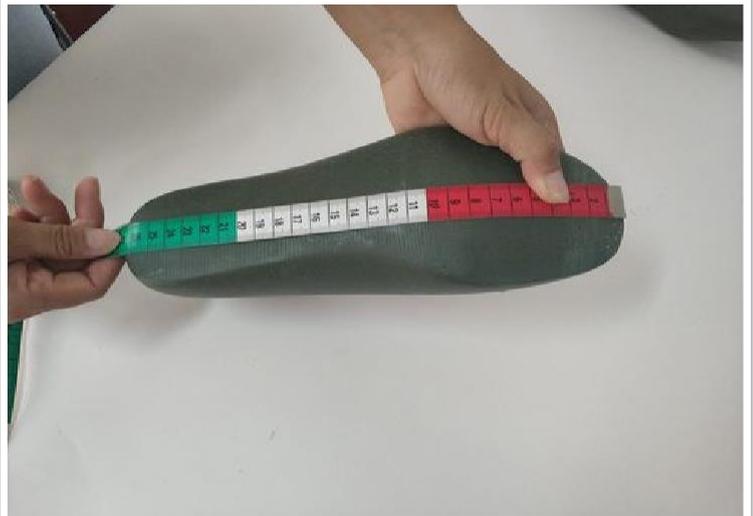


Insole length-size 40

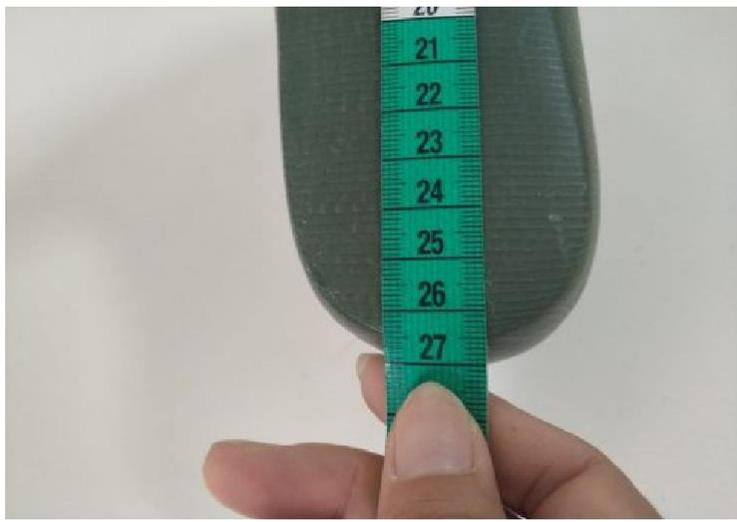


Insole length-size 40




Insole length-size 41

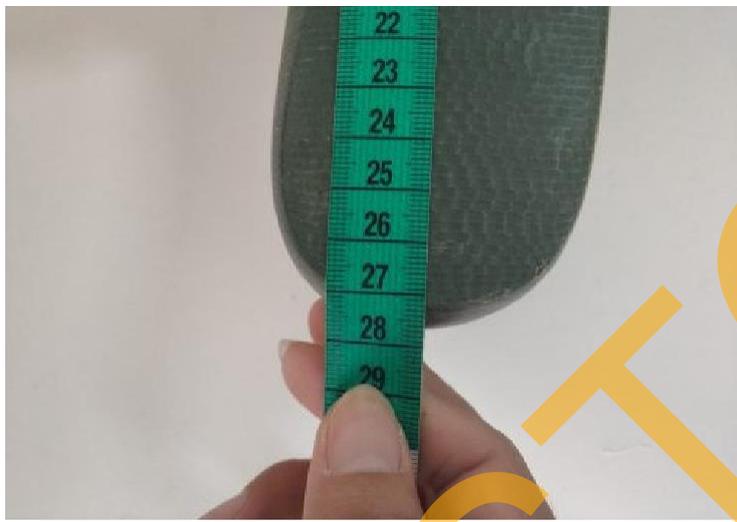


Insole length-size 41

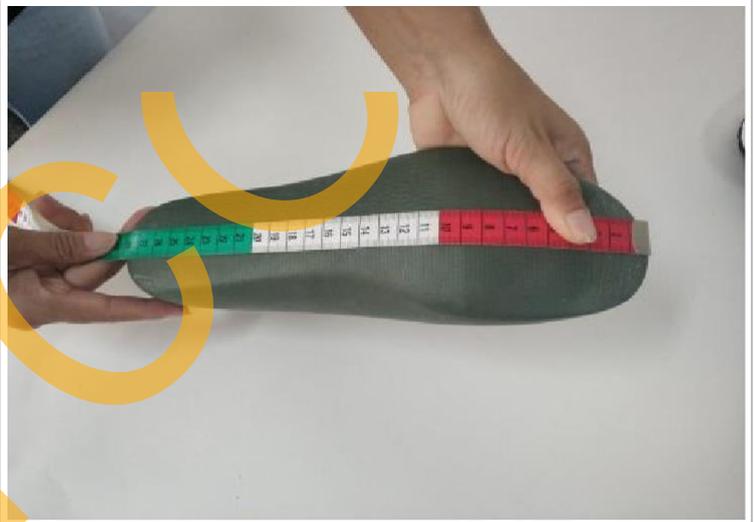


Insole length-size 42

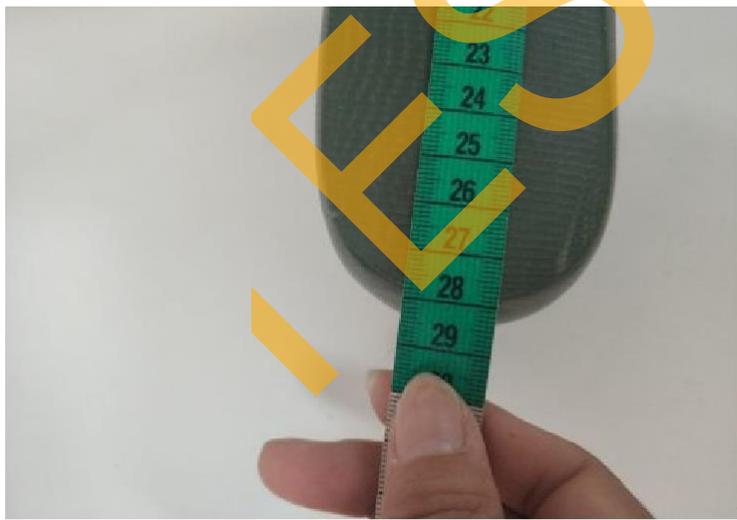


Insole length-size 42

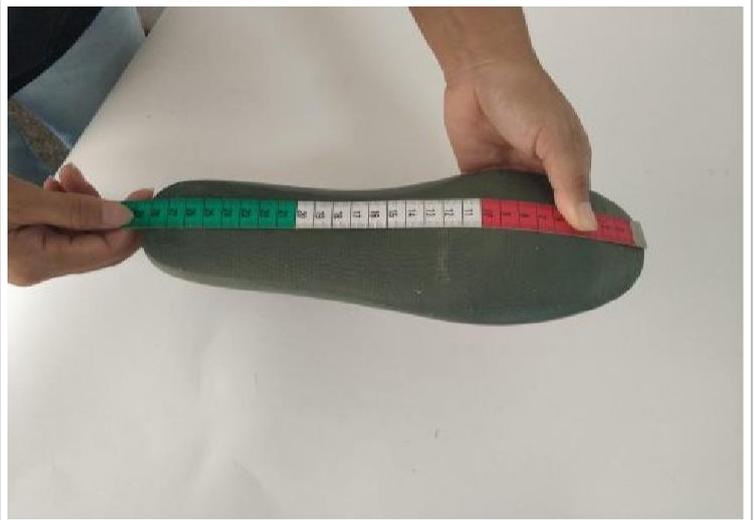

Insole length-size 43

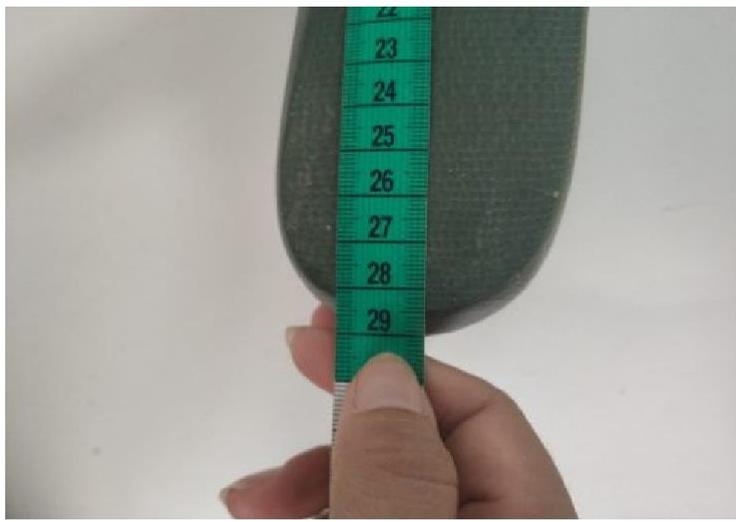


Insole length-size 43

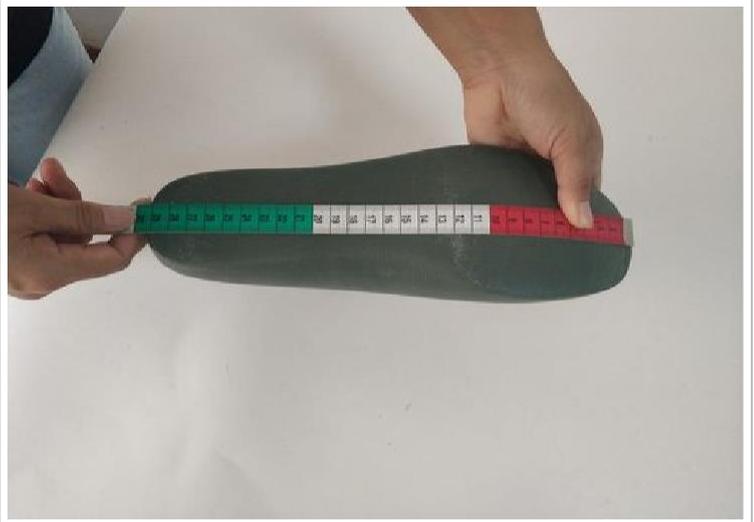

Insole length-size 44



Insole length-size 44

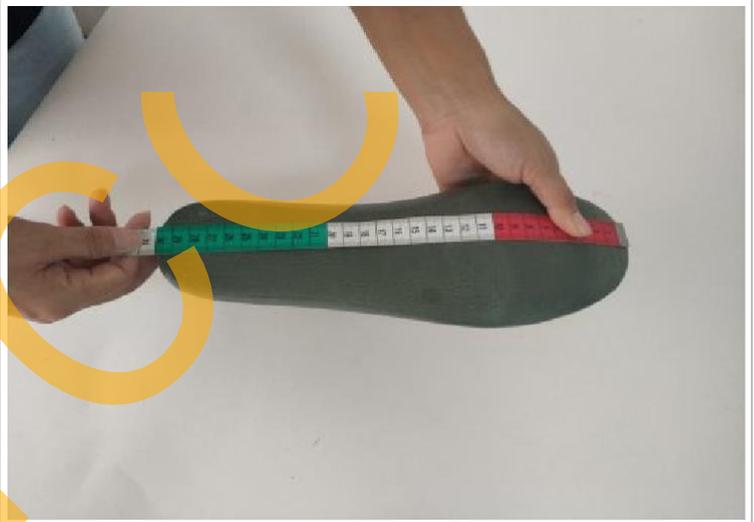

Insole length-size 45



Insole length-size 45



Outsole hardness check



Outsole hardness check



Outsole hardness check



Hanger performance check



RFID alarm inside



Fitting check



Fitting check



Fitting check



Fitting check

Other Images Recorded During Inspection (Factory Gate,Storage,Packing List)



Packed cartons



Packed cartons



Packed cartons



Packed cartons



Under producing



Under producing



Under producing



Under producing



Finished products



Finished products



1 Floor, No.14 building, Small and Medium sized Enterprises Pioneer Park, SSL Industry Park, Dongguan - P.R. CHINA
Tel.: +86 769 23 03 77 70
Fax: +86 769 23 03 77 71
E-mail: cto@testcoo.com

quality@tsp@tsp.ee
safetowear@tsp.ee@inditex.com
denis@v-shine.com.cn
mavis@v-shine.com.cn

TEST REPORT
Report No.: D220611543_1
Page 1/7
17 June 2022



APPLICANT: XIAMEN V-SHINE IMP. & EXP. CO., LTD (厦门威进进出口有限公司 (C01153))
10TH FLOOR, NO.339, SOFTWARE PARK III CHENGYI STREET, JIMEI DISTRICT 集美区软件园三期诚毅大街339号A-03栋10层
XIAMEN FUJIAN CHINA

Date of receipt: 14 June 2022
Testing period: 14 June 2022 - 17 June 2022

Buyer: TEMPE TRADER
Tested sample style no.: 2206/092/040
Text(s) requested: PHYSICAL TEST
Service: REGULAR
Brand / Section: LEFTIES
Season: AW22
End use: ---
Factory name: JIJUJIANG HONGZHAN SHOES PLASTIC CO., LTD
Factory code: 2411
Trader code: 00051
Trader name: XIAMEN V-SHINE IMPORT&EXPORT CO., LTD

Previous report: ---
Product category: MAN SHOE
Product type: MASS PRODUCTION SAMPLE -- CHINA STYLE
Test stage: FIRST TEST
Supplier name: ---
Product code: ---
Trader country: CHINA

1. Conclusion:

Tests description	Conformity
1 Sole bond strength	Pass
2 Colour fastness to rubbing (Dry)	Pass
3 Colour fastness to rubbing (Wet)	Pass
4 Colour migration by ageing	Fail
5 Abrasion resistance for outsole	Pass
6 Flexing resistance of whole shoe	Pass
7 Glue resistance (Ceramic tile)	Pass
8 Interlayer bond strength	Pass

Failed Physical testing from CTC



1 Floor, No.14 building, Small and Medium sized Enterprises Pioneer Park, SSL Industry Park, Dongguan - P.R. CHINA
Tel.: +86 769 23 03 77 70
Fax: +86 769 23 03 77 71
E-mail: cto@testcoo.com

quality@tsp@tsp.ee
safetowear@tsp.ee@inditex.com
denis@v-shine.com.cn
mavis@v-shine.com.cn

TEST REPORT
Report No.: D220715083_1
Page 1/3
29 July 2022



APPLICANT: XIAMEN V-SHINE IMP. & EXP. CO., LTD (厦门威进进出口有限公司 (C01153))
10TH FLOOR, NO.339, SOFTWARE PARK III CHENGYI STREET, JIMEI DISTRICT 集美区软件园三期诚毅大街339号A-03栋10层
XIAMEN FUJIAN CHINA

Date of receipt: 25 July 2022
Testing period: 25 July 2022 - 29 July 2022

Buyer: TEMPE TRADER
Tested sample style no.: 2206/092/040
Text(s) requested: PHYSICAL TEST
Service: REGULAR
Brand / Section: LEFTIES
Season: AW22
End use: ---
Factory name: JIJUJIANG HONGZHAN SHOES PLASTIC CO., LTD
Factory code: 2411
Trader code: 00051
Trader name: XIAMEN V-SHINE IMPORT&EXPORT CO., LTD

Previous report: D220611543_1
Product category: MAN SHOE
Product type: MASS PRODUCTION SAMPLE -- CHINA STYLE
Test stage: SECOND TEST
Supplier name: ---
Product code: ---
Trader country: CHINA

1. Conclusion:

Tests description	Conformity
1 Colour migration by ageing	Pass

Passed Physical testing from CTC



Member of PFI Group

Expertise: C202289611V1
Date: 2022-06-10

Test Report
XIAMEN V-SHINE IMPORT & EXPORT CO., LTD.

Address: 10th Floor, No.339, Chengyi Street, Software Park III, Jimei District, Xiamen, China
Attention: Mavis

The following sample(s) was/were submitted and identified on behalf of the client as:

Sample Information:
(1) Article No.: 2206/092/011, blue shoe lace
(2) Article No.: 2206/092/011, blue mesh
(3) Article No.: 2206/092/011, grey mesh
(4) Article No.: 2206/092/405 & 2206/092/040, black mesh
(5) Article No.: 2206/092/040, dark grey mesh
(6) Article No.: 2206/092/405, lime mesh
(7) Article No.: 2206/092/405 & 2206/092/040, black shoe lace
(8) Article No.: 2206/092/011 & 2206/092/405 & 2206/092/040, transparent shoe lace tip

Test Specification: Client's requirement
Sample Receiving Date: 2022-06-07
Testing Period Date: 2022-06-07 to 2022-06-09
Service: Regular Service
Delivery Conditions: Normal

Summary:

Parameter	Client's requirement
Phthalates	Fail
pH Value	Pass

Test Report
XIAMEN V-SHINE IMPORT & EXPORT CO., LTD.

Address: 10th Floor, No.339, Chengyi Street, Software Park III, Jimei District, Xiamen, China
Attention: Mavis

The following sample(s) was/were submitted and identified on behalf of the client as:

Sample Information: Article No.: 2206/092, transparent shoe lace tip
Test Specification: Client's requirement
Sample Receiving Date: 2022-07-05
Testing Period Date: 2022-07-05 to 2022-07-07
Service: Regular Service
Delivery Conditions: Normal

Summary:

Parameter	Client's requirement
Phthalates	Pass



Member of PFI Group

Expertise: C202290179V1
Date: 2022-07-08

Failed Chemical testing from PFI



Member of PFI Group

Expertise: C202289611V1
Date: 2022-06-10

Test Report
XIAMEN V-SHINE IMPORT & EXPORT CO., LTD.

Address: 10th Floor, No.339, Chengyi Street, Software Park III, Jimei District, Xiamen, China
Attention: Mavis

The following sample(s) was/were submitted and identified on behalf of the client as:

Sample Information:
(1) Article No.: 2206/092/011, blue shoe lace
(2) Article No.: 2206/092/011, blue mesh
(3) Article No.: 2206/092/011, grey mesh
(4) Article No.: 2206/092/405 & 2206/092/040, black mesh
(5) Article No.: 2206/092/040, dark grey mesh
(6) Article No.: 2206/092/405, lime mesh
(7) Article No.: 2206/092/405 & 2206/092/040, black shoe lace
(8) Article No.: 2206/092/011 & 2206/092/405 & 2206/092/040, transparent shoe lace tip

Test Specification: Client's requirement
Sample Receiving Date: 2022-06-07
Testing Period Date: 2022-06-07 to 2022-06-09
Service: Regular Service
Delivery Conditions: Normal

Summary:

Parameter	Client's requirement
Phthalates	Fail
pH Value	Pass

Test Report
XIAMEN V-SHINE IMPORT & EXPORT CO., LTD.

Address: 10th Floor, No.339, Chengyi Street, Software Park III, Jimei District, Xiamen, China
Attention: Mavis

The following sample(s) was/were submitted and identified on behalf of the client as:

Sample Information: Article No.: 2206/092, transparent shoe lace tip
Test Specification: Client's requirement
Sample Receiving Date: 2022-07-05
Testing Period Date: 2022-07-05 to 2022-07-07
Service: Regular Service
Delivery Conditions: Normal

Summary:

Parameter	Client's requirement
Phthalates	Pass



Member of PFI Group

Expertise: C202290179V1
Date: 2022-07-08

Passed Chemical testing from PFI



Inspected samples



Inspected samples